

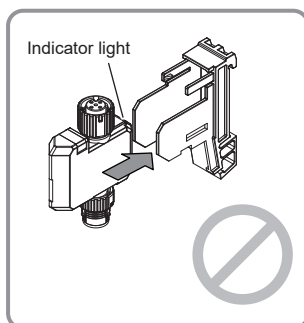


■ Mounting


Step 1: Connect the K3CV to the adapter. Insert it fully with the indicator light facing forward.

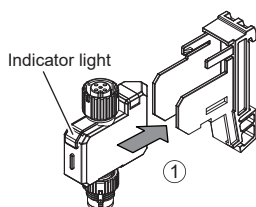

Step 2: Connect the cables for the analog signal side and the IO-Link communication side to the K3CV.

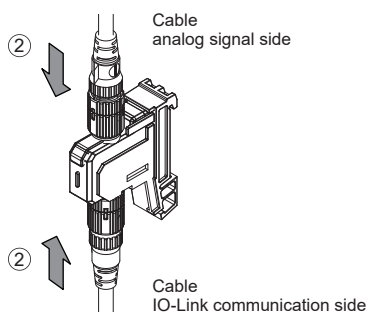


Step 3: Mount the adapter onto the DIN track.

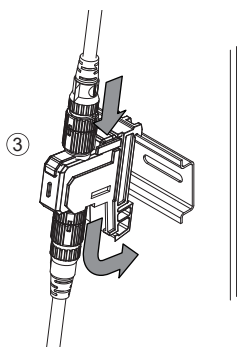


- In environments with strong vibration, install an end plate on the DIN track to prevent lateral movement or detachment of the DIN Track Mounting Adapter.

■ Removal


Step 1: Insert a flathead screwdriver into the slot at the bottom of the adapter and remove the adapter from the DIN track.

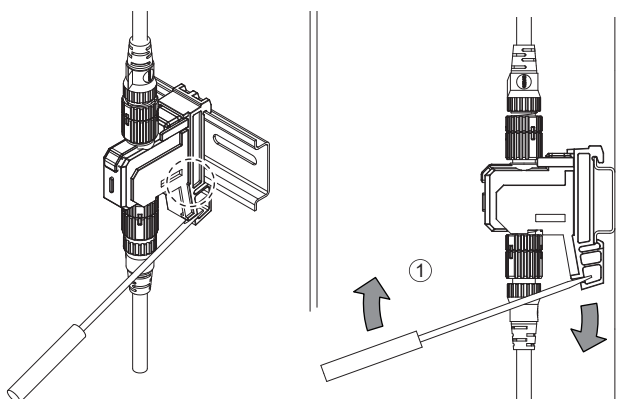


Step 2: Disconnect both cables from the K3CV.

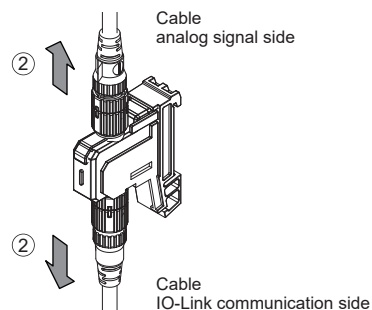

Step 3: Remove the K3CV from the adapter by spreading the upper latch of the adapter with your fingers.

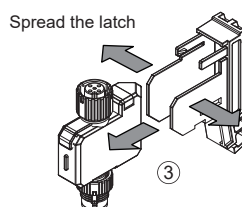

■ Dimensions (Unit: mm)

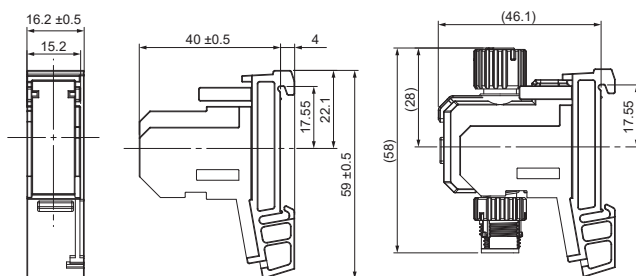

形K3CV-F-3 DIN レール取付アダプタ


OMRON

JPN 取扱説明書


5849384-2A

■取り付け


Step1: K3CV本体とアダプタを取り付けます。
取り付け方向があります。表示灯が手前になるようにして押し込みます。

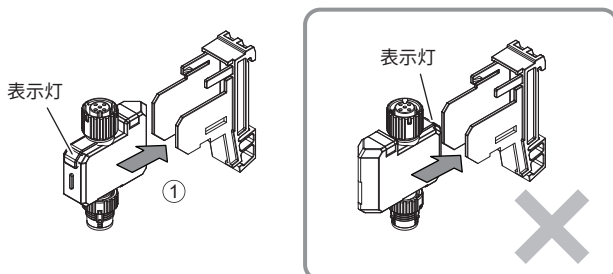

Step2: ケーブル (アナログ信号側とIO-Link通信側) を両側に取り付けます。

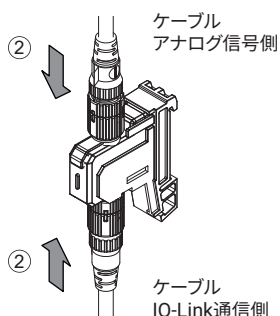


Step3: DINレールに取り付けます。

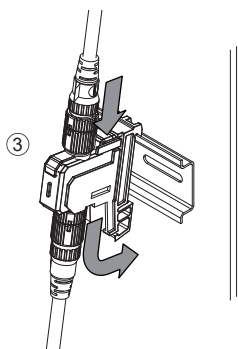


・振動の大きい環境では、DINレールにエンドプレートを着装着してください。DINレール取付アダプタの横移動および脱落を防止します。

■取り外し


Step1: マイナスドライバをアダプタ下部の差込口に入れ、DINレールから取り外します。

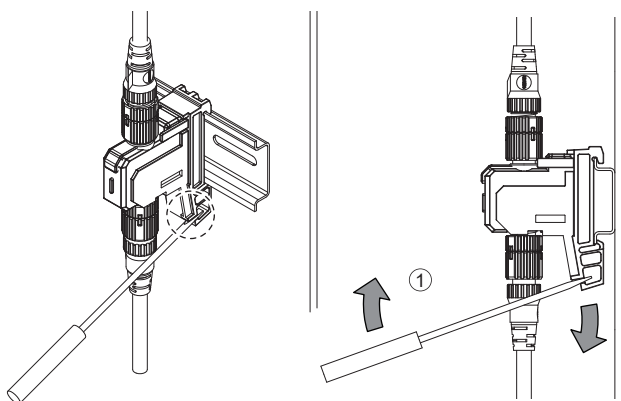

Step2: ケーブルを取り外します。

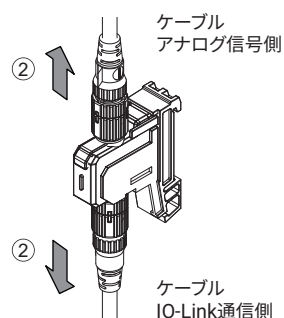

Step3: アダプタからK3CV本体を取り外します。
アダプタの上側の爪部を指で広げながら外します。

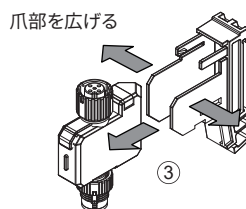

■外形図 (単位: mm)

